STRAIGHT SSK COLLET CHUCK (MILLING)

Coolant-through hole
Clamping Range : ø1.0 ~ ø25.4

CODE No.
ST42 SSK16 165
Shank / SC Collet Size / Length

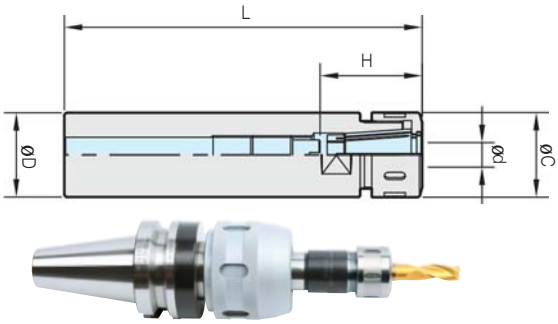

PRODUCT INFORMATION

- 8°Taper 의 강력한 파지력
- 높은 정밀도와 빠른 가공에 적합
- 드릴, 센터드릴, 엔드밀, 탭, 리머용으로 사용

- Powerful clamping force of 8°Taper.
- Excellent Run-out Accuracy.
- SSK COLLET CHUCK is suitable for a various operation using drill, endmill, tap and reamer.

Code No.	ød	øD	L	øC	H		Collet	Weight (kg)
					Min	Max		
ST20 - SSK 6 - 120	0.9~6.0	20	120	19.5	21	35	SC6	0.2
- 180			180					0.4
SSK10 - 140	1.75~10.0		140	27.5	30	50	SC10	0.3
- 200			200					0.5
SSK13 - 150	2.75~13.0		150	33	36	60	SC13	0.5
- 180			180					0.6
- 250			250					0.9
ST25 - SSK10 - 150	1.75~10.0	25	150	27.5	30	50	SC10	0.6
- 210			210					0.9
SSK13 - 150	2.75~13.0		150	33	36	60	SC13	0.7
- 210			210					0.9
SSK16 - 150	2.75~16.0		150	40	45	70	SC16	0.8
- 200			200					1.0
ST32 - SSK10 - 150	1.75~10.0	32	150	27.5	30	50	SC10	0.7
- 200			200					1.1
SSK13 - 150	2.75~13.0		150	33	36	60	SC13	0.9
- 250			250					1.2
SSK16 - 150	2.75~16.0		150	40	45	70	SC16	1.2
- 220			220					1.5
- 280			280					1.8
SSK20 - 165	3.6~20.0		165	48	50	75	SC20	2.0
ST42 - SSK16 - 180	2.75~16.0	42	180	40	45	70	SC16	1.4
- 240			240					1.8
SSK20 - 180	3.6~20.0		180	48	50	75	SC20	1.6
- 240			240					2.0
- 280			280					2.3
SSK25 - 200	15.6~25.4		200	55	55	85	SC25	1.8
- 250			250					2.1
- 300			300					2.5

- 너트, 조절나사 및 콜렛추출도구는 부속되어 있습니다.
- 스페너는 별매입니다. P157
- Synchronized Tap 사용시 SSK10을 사용하십시오.
  Aluminum MAX Tapping M12
  Steel MAX Tapping M10
  Stainless Steel MAX Tapping M8
  위 사양 이상인경우는 Milling Chuck에 K-Collet을 사용하시길 바랍니다.
- SSK척 콜렛은 P144~P145
- 절삭공구 체결시 무리한 힘이 가해질시 너트및 홀더가 파손 될 수 있습니다.

- NUT, ADJUST SCREW, COLLET REMOVER are included.
- Spanner is ordered separately. P157
- Please use SSK10 when you use Synchronized Tap.
  Aluminum MAX Tapping M12
  Steel MAX Tapping M10
  Stainless Steel MAX Tapping M8
  If it has problem, We recommend K COLLET with Milling Chuck.
- SC COLLET is refered. P144 ~ P145
- The nut or shank of chuck can be destoried if you too strongly clamp nut and holder.