


Dual Contact Type

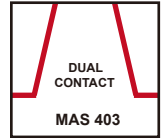


BT-DC type holder can be used for BT double contact spindle and also used for BT standard spindle.

= Dimensions(mm)

BT50DC		D1	D2	D3	D4	L1	L2	L3	L4	Clamping wrench	Adjustment bolt (wrench)	Kg.
BT50DC/GMR6/90	●	6	23	26	50	90	37.5	27.5	32	TR-4.0	M5x0.8(T-2.5)	4.2
BT50DC/GMR6/140	●	6	23	26	50	140	37.5	27.5	44	TR-4.0	M5x0.8(T-2.5)	4.8
BT50DC/GMR8/90	●	8	25	28	50	90	37.5	27.5	32	TR-4.0	M6x1.0(T-3.0)	4.2
BT50DC/GMR8/140	●	8	25	28	50	140	37.5	27.5	44	TR-4.0	M6x1.0(T-3.0)	4.8
BT50DC/GMR10/90	●	10	27	30	50	90	42.5	32.5	32	TR-4.0	M8x1.0(T-4.0)	4.3
BT50DC/GMR10/140	●	10	27	30	50	140	42.5	32.5	44	TR-4.0	M8x1.0(T-4.0)	4.9
BT50DC/GMR12/90	●	12	29	32	50	90	47.5	37.5	32	TR-4.0	M10x1.0(T-5.0)	4.3
BT50DC/GMR12/140	●	12	29	32	50	140	47.5	37.5	44	TR-4.0	M10x1.0(T-5.0)	4.9
BT50DC/GMR14/90	●	14	31	34	50	90	47.5	37.5	32	TR-4.0	M10x1.0(T-5.0)	4.3
BT50DC/GMR14/140	●	14	31	34	50	140	47.5	37.5	44	TR-4.0	M10x1.0(T-5.0)	4.9
BT50DC/GMR16/90	●	16	35	38	50	90	52.5	42.5	32	TR-4.0	M12x1.0(T-6.0)	4.4
BT50DC/GMR16/140	●	16	35	38	50	140	52.5	42.5	48	TR-4.0	M12x1.0(T-6.0)	5.0
BT50DC/GMR18/90	●	18	37	40	50	90	52.5	42.5	32	TR-4.0	M12x1.0(T-6.0)	4.4
BT50DC/GMR18/140	●	18	37	40	50	140	52.5	42.5	48	TR-4.0	M12x1.0(T-6.0)	5.0
BT50DC/GMR20/90	●	20	39	42	50	90	52.5	42.5	32	TR-5.0	M16x1.0(T-6.0)	4.4
BT50DC/GMR20/140	●	20	39	42	50	140	52.5	42.5	48	TR-5.0	M16x1.0(T-6.0)	5.0
BT50DC/GMR25/105	●	25	53	57	-	105	61	51	-	TR-5.0	M16x1.0(T-6.0)	4.9
BT50DC/GMR25/150	●	25	53	57	-	150	61	51	-	TR-5.0	M16x1.0(T-6.0)	5.5
BT50DC/GMR32/115	●	32	58	63	-	115	65	55	-	TR-5.0	M16x1.0(T-6.0)	5.1
BT50DC/GMR32/150	●	32	58	63	-	150	65	55	-	TR-5.0	M16x1.0(T-6.0)	5.9

Availability: ● Stock ▲ Short lead time ○ Made to order

- »h6 shank tools must be used.
- »Tool length can be adjusted up to 10mm.
- »T-wrench is must be ordered separately.
(GRIP torque wrench is recommended.)
- »All products center through coolant system.
- »Additional sizes and special designs available on request.
- »BT-DC type holder can be used for BT double contact spindle
and also used for BT standard spindle.
- ⚠ The minimum tool depth must be observed.

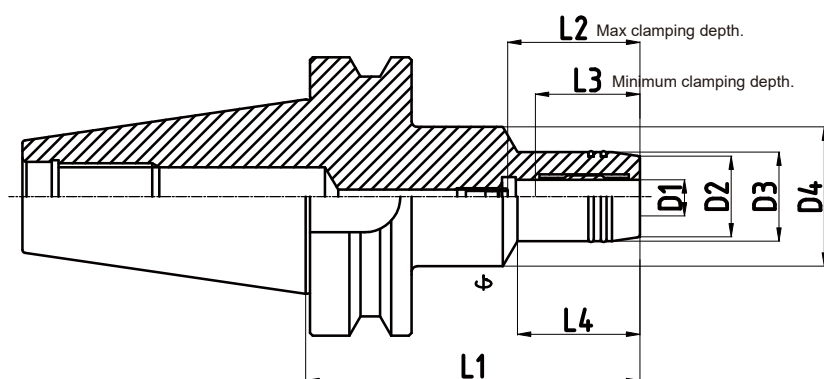

BT50DC